

Work Order ID 145320

Thursday, May 05, 2016 1:32:16 PM

145320**U/R**OK
16/5/19

Page 1

Item ID: D119-646-041

Accept

N900040100

Setup

Start

NS1

Revision ID: URF 15-560

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Stop

NS2

Start Date: 5/18/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/9/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: MLJDate: MAY 06 2016

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

Draw Nbr

Revision Nbr

D3887-041

D

IIN-D119-646

C

100

0.00

100

DC

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy bluefile & type labels per PPP D119-646-041

CHG004

label
DAS
21
9-09

JUL 20 2016

110

0.00

110

Skidtubes

Memo

0.00

Skidtubes

1- inspect Mat'L D2500-1-190 for damage

2-Cut tube to length as per dwg D3887 (154.8")

3- Ensure squareness of ends and scribe batch#

16-6-22 JH

JH

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		FAULT CATEGORY Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : ☐							

Work Order ID 145320

Thursday, May 05, 2016 1:32:16 PM

145320

Page 2

Item ID: D119-646-041**Accept*****N900040100*****Setup Start *NS1*****Revision ID:** URF 15-560**Stop *NS2*****Item Name:** Replacement Skidtube with Wearpads, Fits LH or RH**Start Date:** 5/18/2016 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 6/9/2016 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	Chemical Conversion Coat per QSI005 4.1	0.00							
120									
HandFinish	Memo	0.00							
Hand Finishing									
121	QC7-Inspect Chemical Conversion Coat	0.00							
121									
QC	Memo	0.00							
Quality Control									
122	QC5- Inspect part completeness to step on W/O	0.00							
122									
QC	Memo	0.00							
Quality Control									

DAS
18
9-89DAS
18
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 145320

Thursday, May 05, 2016 1:32:16 PM

145320

Page 3

Item ID: D119-646-041

Accept

N900040100

Setup Start

NS1

Revision ID: URF 15-560

Stop

NS2

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 5/18/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/9/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run

Start

NR1

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool # Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

130

0.00

130

Skidtubes

Skidtubes

Memo

0.00

1- Install drill Jig DT9477 drill X-bolt spacer pilot holes using 3/16" drill first side only.

2- 2nd side, locating from first saddle holes use DT9861 A/B to drill 2nd side fwd saddle holes.

3- 2nd side locating from fwd saddle drill remaining crossbolt spacer holes using DT9477

4- Open crossbolt spacer holes to finished size as per dwg D3887 (section D-D and E-E) ***DO NOT OPEN FWD Saddles Holes***

5- Deburr, blow out chips from inside of tube.

6- Bond web in place as per Dwg D3887 & QSI 015.

A/R Sikaflex-291 134743Sikaflex expire date: 16-12-8Start: _____ Time: 13455

Finish: _____ Time: _____

***** (Adhere for 12 hours) *****

16-6-23 MG

16-6-23 MG

16-6-23 MG

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

Work Order ID 145320

Thursday, May 05, 2016 1:32:16 PM

145320

Page 4

Item ID: D119-646-041**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:** URF 15-560**Stop*****NS2*****Item Name:** Replacement Skidtube with Wearpads, Fits LH or RH**Start Date:** 5/18/2016 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 6/9/2016 **Req'd Qty:** 1.00***1*****Customer:****Reference:****Approvals:****Process Plan:** _____**Date:** _____**Tooling:** _____**Date:** _____**Run Start*****NR1*****QC:** _____**Date:** _____**SPC (Y/N):** _____**Date:** _____**Stop*****NR2*****Sequence ID/
Work Center ID****Operation
Description****Set Up/
Run Hours****Tool ID****Tool #****Plan
Code****Accept
Qty****Reject
Qty****Reject
Number****Insp.
Stamp**

135

QC5- Inspect part completeness to step on W/O

0.00

135

QC

Memo

0.00

Quality Control

DAS
18
8-091 0 16-06-27

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 145320

Thursday, May 05, 2016 1:32:16 PM

145320

Page 5

Item ID: D119-646-041

Accept

N900040100Setup Start ***NS1***

Revision ID: URF 15-560

Stop ***NS2***

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 5/18/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/9/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

0.00

140

Skid tubes

Skid tubes

Memo

0.00

1- Bend FWD end of tube using bender 1 and FOLIO 31 bend prog.
D3887.***Must use bending aid DT9544, ensure proper positioning***

2- Cut FWD end of tube as per dwg D3887.***Verify measurement***

3- Buff out marks left from bending

4- Drill FWD cap holes using DT8215. Open FWD & AFT cap holes to 0.208"

5- Open FWD saddle holes to finished size as per dwg D3887

6- Drill FWD x-bolt spacer holes using DT9816 and open to finished
size.(verify measurement)7- Drill Tow ring hole, using DT10047 locate from FWD saddle hole. (verify
neasurement). Open to finished size.8- Drill 1.87" and 3.74 holes using DT10045 A&B locate from FWD saddle
hole. (verify measurement) as per dwg.

9- C'sink FWD cap hole as per detail "C"

10- Drill holes for wearpads using DT8931, open to 0.297".

11- Countersink crossbolt spacer holes, and prepare tube for welding, deburr.

12- Deburr and blow out chips from inside of tube.

16-6-27 JH

16-6-27 M-G

16-6-28 JH

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																											
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																								
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																							
Root Cause		FAULT CATEGORY																																																													
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : 	
Misidentified ☐	Past Due ☐																																																														

Work Order ID 145320

145320

Page 6

Thursday, May 05, 2016 1:32:16 PM

Item ID: D119-646-041 Accept *N900040100* Setup Start *NS1*
Revision ID: URF 15-560 Stop *NS2*
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 5/18/2016 Start Qty: 1.00 *1* Cust Item ID:
Required Date: 6/9/2016 Req'd Qty: 1.00 *1* Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150

QC5- Inspect part completeness to step on W/O 0.00

150

QC

Memo

0.00

Quality Control

DAS
18
9-09

1 8 16-06-29

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Work Order ID 145320

145320

Page 7

Thursday, May 05, 2016 1:32:16 PM

Item ID: D119-646-041 Accept *N900040100* Setup Start *NS1*
Revision ID: URF 15-560 Stop *NS2*
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 5/18/2016 Start Qty: 1.00 *1* Cust Item ID:
Required Date: 6/9/2016 Req'd Qty: 1.00 *1* Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160		0.00							
160									
Skidtubes	Memo	0.00							
Skidtubes	NOTE:TACK IN 2 MOST FWD X-BOLT SPACERS AND TEST FIT FWD GROUND HANDELING FIXTURE,IF FIXTURE FITS WELL THEN PROCEED. FIXTURE DT10091.								
	1-Insert crossbolt spacers. Weld as per QSI 004 and Dwg D3887. Remember to back drill each hole before welding the other side. Use aluminum rod A/RAluminum Rod <u>m134826</u>								
	2-Grind cross bolt welds flush as per Dwg D3887. Ensure no pin hole.								
	3-Counterbore 5/16" x 0.750" deep as per Dwg D3887. - <u>16-6-29 M.G./H</u>								
	4- Deburr & Scribe batch # on Aft end of tube. <u>16-6-30 M.G./H</u>								
170	QC5- Inspect part completeness to step on W/O	0.00							
170									
QC	Memo	0.00							
Quality Control	TEST FIT USING FIXTURE DT10091.								

DAS
9
9-89

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

Work Order ID 145320

145320

Page 8

Thursday, May 05, 2016 1:32:16 PM

Item ID: D119-646-041 **Accept** ***N900040100*** **Setup Start** ***NS1***
Revision ID: URF 15-560 **Stop** ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 5/18/2016 **Start Qty:** 1.00 ***1*** **Cust Item ID:**
Required Date: 6/9/2016 **Req'd Qty:** 1.00 ***1*** **Customer:**
Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____ **Run Start** ***NR1***
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____ **Stop** ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180	QC10- Inspect visual per QSI004- ground welds	0.00							
180									
QC	Memo	0.00							DAS 9 9-89
Quality Control									
190	Pressure Wash per QSI005 4.3	0.00							
190									
HandFinish	Memo	0.00							
Hand Finishing	Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.								
200	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
200									
Powdercoat	Memo	0.00							
Powder Coating	START TIME: 3:35 OVEN TEMPERATURE: 320 FINISH TIME: 3:55								


 SEE
 Attached

P.T.O.

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 15%;">Skid-tube ☐</td> <td style="width: 15%;">Cross tube ☐</td> <td style="width: 15%;">Water Jet ☐</td> <td style="width: 15%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date : _____		Step #: _____		QTY Effective : _____			MRB (QS1042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																		
Description Work Order Deviation				Disposition																					

Root Cause				FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		
OTHER : _____							

Work Order ID 145320

Thursday, May 05, 2016 1:32:16 PM

145320

Page 9

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 5/18/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 6/9/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210	QC3- Inspect Part Finish	0.00							
210									
QC	Memo	0.00							
Quality Control									
220		0.00							
220									
HandFinish	Memo	0.00							
Hand Finishing	1-Install inserts as per Dwg D3887.								
230	QC5- Inspect part completeness to step on W/O	0.00							
230									
QC	Memo	0.00							
Quality Control									

1x of all 16/07/08 15 9:00

1x of all 16/03/08

1 of 16-7-8. 15 9:00

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐		
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐		
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐		
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐		
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐		
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐		
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐		
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐		
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐		
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐		
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____					
Misidentified ☐	Past Due ☐						

Work Order ID 145320

Thursday, May 05, 2016 1:32:16 PM

145320

Page 10

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 5/18/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 6/9/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240		0.00							
240									
HandFinish									
Hand Finishing									
	Memo	0.00							
	1-Install wearpads, gaskets as per Dwg D3887. Put sikaflex in insert before installing bolts and washers								
	A/R Sikaflex-240/-291 <u>13134083</u>								
	Sikaflex expire date: <u>1612</u>								
	2-assemble o'ring to plug as per dwg D3492 and apply o'ring lube								
	A/R 55-o'ring lube batch: <u>M11331+5</u>								
	<u>RTU 598 M1135047 1612</u>								
	3 -Inspect for foreign objects as per QSI 024								
	4 -Install Aft Cap and seal with Sikaflex. Clean excess adhesive.								
	A/R Sikaflex-240/-291 <u>M1134743</u>								
	Sikaflex expire date: <u>1612</u>								
245	QC5- Inspect part completeness to step on W/O	0.00							
245									
QC									
Quality Control	Memo	0.00							

★
SEE
Attached

14 1 111 16102/08

P.T.O.

1 1 DAS 38 380
JUL 14 2016

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Thursday, May 05, 2016 1:32:16 PM

Page 11

[illegible]

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : ☐					

Work Order ID 145320

Thursday, May 05, 2016 1:32:16 PM

145320

Page 12

Item ID: D119-646-041**Accept*****N900040100*****Setup Start *NS1*****Revision ID:** URF 15-560**Stop *NS2*****Item Name:** Replacement Skidtube with Wearpads, Fits LH or RH**Start Date:** 5/18/2016 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 6/9/2016 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
270	QC21- Final Inspection - Work Order Release	0.00							
270									
QC	Memo	0.00							
Quality Control									

 16/07/22

MCJ

DAS
21
9-89

JUL 20 2016

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QS1042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐							
		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : _____							

Picklist Print

Thursday, May 05, 2016 1:32:20 PM

Page 1

Work Order ID: 145320

145320

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 5/18/2016

Required Date: 6/9/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP RevA: New issue DD verified by:EC
10.02.22 per PAR 09-043 EC verified by:DD IPP rev B
DEOD3887-B-1)(ecn 12-675) DD verf:JLM IPP REV:D 13.03.20 per
chg003 ECN13-534 DD verf:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2500-1-190		Manufactured	No			110	Each	65.0000	1	1			
D2500-1-190									**				
Ext'n -T' Beam Tube 4"													
					<u>Location</u>			<u>Loc Qty</u>		<u>Loc Code</u>			
					LG002			65					
					140538			65					
D2579		Manufactured	No			140	Each	199.0000	2	2			
D2579									**				
Crossbolt Spacer													
					<u>Location</u>			<u>Loc Qty</u>		<u>Loc Code</u>			
					LG001			199					
					123997			1					
					141711			198					
D2855-3		Manufactured	No			240	Each	33.0000	2	2			
D2855-3									**				
Cap													
					<u>Location</u>			<u>Loc Qty</u>		<u>Loc Code</u>			
					FP001			33					
					137525			33					

16-06-22/16

BB16-06-29

20 16/07/08

13 142564

K2

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause			FAULT CATEGORY								
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____							
Misidentified	☐	Past Due	☐								

Picklist Print

Thursday, May 05, 2016 1:32:20 PM

Page 2

Work Order ID: 145320

145320

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 5/18/2016

Required Date: 6/9/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1611-005

Purchased

No

240

Each

463.0000

16

16

NAS1611-005

O-RING

**

all 1610210

Location

Loc Qty

Loc Code

FP001

463

B134816

x16

m129198

11

m133498

316

m134488

136

D3492-5

Manufactured

No

240

Each

52.0000

16

16

D3492-5

Plug

**

all 1610210

Location

Loc Qty

Loc Code

FP001

52

B142818

x16

133396

8

136396

6

138198

2

141422

36

D3672-1

Manufactured

No

240

Each

634.0000

2

2

D3672-1

Washer, Phenolic

**

all 1610210

Location

Loc Qty

Loc Code

FG

10

85222

10

FP001

70

112218

70

x2

ST049

54

127322

54

ST051A

500

134785

500

QA Closed: _____ Date: _____

Work Order update only

Work Order: _____		DISPOSITION		AGAINST DEPARTMENT/PROCESS							
Part No. _____		Rework ☐		Skid-tube ☐		Cross tube ☐		Water Jet ☐		Engineering ☐	
NCR No. _____		Scrap ☐		Machining ☐		Small Fab ☐		Prod. Eng. Coord. ☐		Quality ☐	
		Use-as-is ☐		Thermoforming ☐		Finishing ☐		Rec/Store/Packaging ☐		Other ☐	
		Suspected Unapproved ☐		Large Fab ☐		Composite ☐		Supplier ☐			
Date :		Step #:		QTY Effective :						MRB (QS1042) Approval	
Description Work Order Deviation				Disposition						Completed By	
										Lead hand / Supervisor Approval Verification	
										QC / QA Coordinator Approval	
Root Cause Environment ☐ No Re-verification ☐ Design ☐ Operator ☐ Doc/Data ☐ Offset/Setup ☐ Equip/Tooling ☐ Supplier ☐ Handling/Pre ☐ Training ☐ Material ☐ Use for Testing ☐ Internal Transport ☐ Poor Information ☐ Tribal Knowledge ☐ Rushing ☐ LOA ☐ Product Improvement ☐ Substation ☐ Process Improvement ☐ Past Expiry Date ☐ Manufacturing Process ☐ Misidentified ☐ Past Due ☐				FAULT CATEGORY ☐ Pressure/Forced ☐ Temperature/Cure ☐ Power Loss/Surge ☐ Positioned Wrong ☐ Bending ☐ Set-up ☐ Folio/Program ☐ Outside Dimensions ☐ Centre Not Concentric ☐ BOM/Route ☐ Grain ☐ Over/Under tolerance ☐ Cracks ☐ Broken/Damage/Defect ☐ Weld ☐ Part Incorrect ☐ Crimp/Kink/Ripple/Wave ☐ Inspection Incomplete/Unqualified ☐ Wrong Stock Pulled ☐ Part Lost/Missing ☐ Cuffs ☐ Contamination ☐ Out of Sequence ☐ Part Moved ☐ Crushing ☐ Countersink ☐ Off-set ☐ Drawing ☐ Heat Treat ☐ Cut Too Short ☐ Mislabeled ☐ Finish ☐ Wave/Twist in Tube ☐ Instructions Incomplete/Unclear ☐ Fit/Function ☐ Misread ☐ Marks/Chatter ☐ Drill Holes ☐ Misaligned/off center ☐ Turning Sequence							
OTHER :											

Picklist Print

Thursday, May 05, 2016 1:32:20 PM

Page 3

Work Order ID: 145320

145320

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 5/18/2016

Required Date: 6/9/2016

Start Qty: 1.00

Required Qty: 1.00

D3681-1

Manufactured No

160

Each

168.0000

8

8

D3681-1

Spacer

**

BE16-06-29

Location

Loc Qty

Loc Code

LG001

168

142904

168

8

D3847-1

Manufactured No

240

Each

35.0000

5

5

D3847-1

Wearpad

**

16102108

Location

Loc Qty

Loc Code

FP001

35

138338

10

142743

3

142854

22

B142745

45

D3847-11

Manufactured No

240

Each

40.0000

1

1

D3847-11

Wearpad

**

16102108

Location

Loc Qty

Loc Code

FP001

40

138418

1

141896

15

142783

24

B146945

XL

D3885-1

Manufactured No

140

Each

3.0000

1

1

D3885-1

Standard Web

**

16-6-28 MG

Location

Loc Qty

Loc Code

LG002

3

142573

3

①

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																											
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																								
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																							
Root Cause		FAULT CATEGORY																																																													
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :	
Misidentified ☐	Past Due ☐																																																														

Picklist Print

Thursday, May 05, 2016 1:32:20 PM

Page 4

Work Order ID: 145320

145320

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 5/18/2016

Required Date: 6/9/2016

Start Qty: 1.00

Required Qty: 1.00

D3903-1 Manufactured No 160 Each 350.0000 12 12

D3903-1

Spacer

*******BE160629*LocationLoc QtyLoc Code

LG001

350

142730

350

ALS4-1032-130

AELS4-1032-130

Purchased

No

220

Each

4,742.000

30

12
30*******all 16/07/08****ALS4-1032-130***

Rivnut

LocationLoc QtyLoc Code

CCK005

2900

M134502

2900

FP001

1842

M133077

172

M134502

1670

AN3CSA

Purchased

No

240

Each

1,471.000

32

x30
32*******all 16/07/08****AN3CSA***

Bolt

LocationLoc QtyLoc Code

FG

5

122800

5

FP001

10

M133686

10

OVER002

1400

M134502

1000

M134676

400

ST350

56

M133234

56

x32

Thursday, May 05, 2016 1:32:20 PM

Shop Packet Print

Page 4

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		

Root Cause				FAULT CATEGORY			
Environment ☐		No Re-verification ☐		Pressure/Forced ☐		Temperature/Cure ☐	
Design ☐		Operator ☐		Bending ☐		Set-up ☐	
Doc/Data ☐		Offset/Setup ☐		Centre Not Concentric ☐		BOM/Route ☐	
Equip/Tooling ☐		Supplier ☐		Cracks ☐		Broken/Damage/Defect ☐	
Handling/Pre ☐		Training ☐		Crimp/Kink/Ripple/Wave ☐		Inspection Incomplete/Unqualified ☐	
Material ☐		Use for Testing ☐		Cuffs ☐		Contamination ☐	
Internal Transport ☐		Poor Information ☐		Crushing ☐		Countersink ☐	
Tribal Knowledge ☐		Rushing ☐		Heat Treat ☐		Cut Too Short ☐	
LOA ☐		Product Improvement ☐		Wave/Twist in Tube ☐		Instructions Incomplete/Unclear ☐	
Substation ☐		Process Improvement ☐		Marks/Chatter ☐		Drill Holes ☐	
Past Expiry Date ☐		Manufacturing Process ☐		OTHER : ☐			
Misidentified ☐		Past Due ☐					

Picklist Print

Page 5

Thursday, May 05, 2016 1:32:20 PM

Work Order ID: 145320

145320

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 5/18/2016

Required Date: 6/9/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

Each

3,049.000

32

NAS1149C0332R******

del 16/07/08

WASHER

LocationLoc QtyLoc Code

FP001

1582

N1134962

m132262

4

X32

m132930

1004

m134063

446

m134073

128

GA

225

m133284

225

ST266

1242

m134474

142

m134574

1000

m134654

100

MS24694-C52

Purchased

No

Each

101.0000

2

MS24694-C52******

del 16/07/08

SCREW

LocationLoc QtyLoc Code

FP001

95

m127059

17

m133855

78

X2

ST287

6

124308

6

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE




QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		FAULT CATEGORY Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : ☐							

8 7 6 5 4 3 2 1

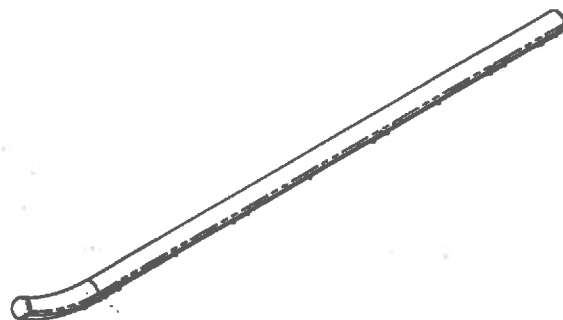

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD (SHOWN)
D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE (SIMILAR)
D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

ITEM	QTY -041	QTY -043	QTY -045	PN	DESCRIPTION
1	X			D3887-041	STD SKIDTUBE ASSY WITH WEARPAD
2		X		D3887-043	STD SKIDTUBE ASSY WITH WEARPLATE
3			X	D3887-045	STD SKIDTUBE ASSY WITH TRAINING WEARPLATE
10	2	2	2	D2578	CROSS BOLT SPACER
11	2	2	2	D2855-3	CAP
12	18	18		D3482-045	PLUG ASSY
13	2	2	2	D3872-1	PHENOLIC WASHER
14	8	8	8	D3881-1	SPACER
17	5	5		D3847-1	WEARPAD
18	1	1		D3847-11	AFT WEARPAD
19		1		D3847-043	FWD WEARPLATE ASSY
20		1		D3847-045	CENTER WEARPLATE ASSY
21		1		D3847-047	AFT WEARPLATE ASSY
22			1	D3848-041	FWD TRAINING WEARPLATE ASSY
23			1	D3848-043	AFT WEARPLATE ASSY
24	1	1	1	D3885-1	STANDARD WEB
25	1	1		D3887-11	STANDARD SKIDTUBE
26			1	D3887-13	STANDARD SKIDTUBE
27	12	12	12	D3803-1	SPACER
28			18	D3804-1	WASHER
41	30	30		AL84-1032-130	INSERT
42	32	32	2	AN3C5A	BOLT
43			8	AN3C46A	BOLT
44	32	32		NAS1148C0332R	WASHER (OR AN980C10L)
45			8	MS21043-3	NUT
46	2	2	2	MS24894-C52	SCREW

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3885-1 WEB
POWDER COAT "WHITE" (4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.006 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D3887-041 = 32.0 lbs
D3887-043 = 37.0 lbs
D3887-045 = 38.1 lbs
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 6.5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020" DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 10) INSERT D3885-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH SIKAFLEX-2411-291 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP
- 11) INSERT D3482-045 PLUG ASSY INTO Ø0.187 HOLES (BOTH SIDES OF TUBE)
- 12) USE DART DRILL TEMPLATE DT8831 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARPLATE INSERTS. INSTALL AEL8-1032-130 INTO D3887-11 ONLY. INSTALL AN3C5A BOLTS AND NAS1148C0332R WASHERS WITH SIKAFLEX-2411-291.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 145320 MJS
16-05-06

RELEASED

2014 NOV 24
ECN 14-628

UNDER REVIEW

15.04.30 URF15-560 AP

D	REVISED BEND TOLERANCES FOR MANUFACTURABILITY, 13.017 WAS 134.04 (2N D4-3), ADD 0.07 (2N C5-8), ADD 116.8 (2N D5-6), DELETE 64.216 (2N D4-1, 81-2)		DB	13.09.20
C	CHG THE 2N C5-8, C5-9, C5-10, C5-11, C5-12, C5-13, C5-14, C5-15, C5-16, C5-17, C5-18, C5-19, C5-20, C5-21, C5-22, C5-23, C5-24, C5-25, C5-26, C5-27, C5-28, C5-29, C5-30, C5-31, C5-32, C5-33, C5-34, C5-35, C5-36, C5-37, C5-38, C5-39, C5-40, C5-41, C5-42, C5-43, C5-44, C5-45, C5-46, C5-47, C5-48, C5-49, C5-50, C5-51, C5-52, C5-53, C5-54, C5-55, C5-56, C5-57, C5-58, C5-59, C5-60, C5-61, C5-62, C5-63, C5-64, C5-65, C5-66, C5-67, C5-68, C5-69, C5-70, C5-71, C5-72, C5-73, C5-74, C5-75, C5-76, C5-77, C5-78, C5-79, C5-80, C5-81, C5-82, C5-83, C5-84, C5-85, C5-86, C5-87, C5-88, C5-89, C5-90, C5-91, C5-92, C5-93, C5-94, C5-95, C5-96, C5-97, C5-98, C5-99, C5-100, C5-101, C5-102, C5-103, C5-104, C5-105, C5-106, C5-107, C5-108, C5-109, C5-110, C5-111, C5-112, C5-113, C5-114, C5-115, C5-116, C5-117, C5-118, C5-119, C5-120, C5-121, C5-122, C5-123, C5-124, C5-125, C5-126, C5-127, C5-128, C5-129, C5-130, C5-131, C5-132, C5-133, C5-134, C5-135, C5-136, C5-137, C5-138, C5-139, C5-140, C5-141, C5-142, C5-143, C5-144, C5-145, C5-146, C5-147, C5-148, C5-149, C5-150, C5-151, C5-152, C5-153, C5-154, C5-155, C5-156, C5-157, C5-158, C5-159, C5-160, C5-161, C5-162, C5-163, C5-164, C5-165, C5-166, C5-167, C5-168, C5-169, C5-170, C5-171, C5-172, C5-173, C5-174, C5-175, C5-176, C5-177, C5-178, C5-179, C5-180, C5-181, C5-182, C5-183, C5-184, C5-185, C5-186, C5-187, C5-188, C5-189, C5-190, C5-191, C5-192, C5-193, C5-194, C5-195, C5-196, C5-197, C5-198, C5-199, C5-200, C5-201, C5-202, C5-203, C5-204, C5-205, C5-206, C5-207, C5-208, C5-209, C5-210, C5-211, C5-212, C5-213, C5-214, C5-215, C5-216, C5-217, C5-218, C5-219, C5-220, C5-221, C5-222, C5-223, C5-224, C5-225, C5-226, C5-227, C5-228, C5-229, C5-230, C5-231, C5-232, C5-233, C5-234, C5-235, C5-236, C5-237, C5-238, C5-239, C5-240, C5-241, C5-242, C5-243, C5-244, C5-245, C5-246, C5-247, C5-248, C5-249, C5-250, C5-251, C5-252, C5-253, C5-254, C5-255, C5-256, C5-257, C5-258, C5-259, C5-260, C5-261, C5-262, C5-263, C5-264, C5-265, C5-266, C5-267, C5-268, C5-269, C5-270, C5-271, C5-272, C5-273, C5-274, C5-275, C5-276, C5-277, C5-278, C5-279, C5-280, C5-281, C5-282, C5-283, C5-284, C5-285, C5-286, C5-287, C5-288, C5-289, C5-290, C5-291, C5-292, C5-293, C5-294, C5-295, C5-296, C5-297, C5-298, C5-299, C5-300, C5-301, C5-302, C5-303, C5-304, C5-305, C5-306, C5-307, C5-308, C5-309, C5-310, C5-311, C5-312, C5-313, C5-314, C5-315, C5-316, C5-317, C5-318, C5-319, C5-320, C5-321, C5-322, C5-323, C5-324, C5-325, C5-326, C5-327, C5-328, C5-329, C5-330, C5-331, C5-332, C5-333, C5-334, C5-335, C5-336, C5-337, C5-338, C5-339, C5-340, C5-341, C5-342, C5-343, C5-344, C5-345, C5-346, C5-347, C5-348, C5-349, C5-350, C5-351, C5-352, C5-353, C5-354, C5-355, C5-356, C5-357, C5-358, C5-359, C5-360, C5-361, C5-362, C5-363, C5-364, C5-365, C5-366, C5-367, C5-368, C5-369, C5-370, C5-371, C5-372, C5-373, C5-374, C5-375, C5-376, C5-377, C5-378, C5-379, C5-380, C5-381, C5-382, C5-383, C5-384, C5-385, C5-386, C5-387, C5-388, C5-389, C5-390, C5-391, C5-392, C5-393, C5-394, C5-395, C5-396, C5-397, C5-398, C5-399, C5-400, C5-401, C5-402, C5-403, C5-404, C5-405, C5-406, C5-407, C5-408, C5-409, C5-410, C5-411, C5-412, C5-413, C5-414, C5-415, C5-416, C5-417, C5-418, C5-419, C5-420, C5-421, C5-422, C5-423, C5-424, C5-425, C5-426, C5-427, C5-428, C5-429, C5-430, C5-431, C5-432, C5-433, C5-434, C5-435, C5-436, C5-437, C5-438, C5-439, C5-440, C5-441, C5-442, C5-443, C5-444, C5-445, C5-446, C5-447, C5-448, C5-449, C5-450, C5-451, C5-452, C5-453, C5-454, C5-455, C5-456, C5-457, C5-458, C5-459, C5-460, C5-461, C5-462, C5-463, C5-464, C5-465, C5-466, C5-467, C5-468, C5-469, C5-470, C5-471, C5-472, C5-473, C5-474, C5-475, C5-476, C5-477, C5-478, C5-479, C5-480, C5-481, C5-482, C5-483, C5-484, C5-485, C5-486, C5-487, C5-488, C5-489, C5-490, C5-491, C5-492, C5-493, C5-494, C5-495, C5-496, C5-497, C5-498, C5-499, C5-500, C5-501, C5-502, C5-503, C5-504, C5-505, C5-506, C5-507, C5-508, C5-509, C5-510, C5-511, C5-512, C5-513, C5-514, C5-515, C5-516, C5-517, C5-518, C5-519, C5-520, C5-521, C5-522, C5-523, C5-524, C5-525, C5-526, C5-527, C5-528, C5-529, C5-530, C5-531, C5-532, C5-533, C5-534, C5-535, C5-536, C5-537, C5-538, C5-539, C5-540, C5-541, C5-542, C5-543, C5-544, C5-545, C5-546, C5-547, C5-548, C5-549, C5-550, C5-551, C5-552, C5-553, C5-554, C5-555, C5-556, C5-557, C5-558, C5-559, C5-560, C5-561, C5-562, C5-563, C5-564, C5-565, C5-566, C5-567, C5-568, C5-569, C5-570, C5-571, C5-572, C5-573, C5-574, C5-575, C5-576, C5-577, C5-578, C5-579, C5-580, C5-581, C5-582, C5-583, C5-584, C5-585, C5-586, C5-587, C5-588, C5-589, C5-590, C5-591, C5-592, C5-593, C5-594, C5-595, C5-596, C5-597, C5-598, C5-599, C5-600, C5-601, C5-602, C5-603, C5-604, C5-605, C5-606, C5-607, C5-608, C5-609, C5-610, C5-611, C5-612, C5-613, C5-614, C5-615, C5-616, C5-617, C5-618, C5-619, C5-620, C5-621, C5-622, C5-623, C5-624, C5-625, C5-626, C5-627, C5-628, C5-629, C5-630, C5-631, C5-632, C5-633, C5-634, C5-635, C5-636, C5-637, C5-638, C5-639, C5-640, C5-641, C5-642, C5-643, C5-644, C5-645, C5-646, C5-647, C5-648, C5-649, C5-650, C5-651, C5-652, C5-653, C5-654, C5-655, C5-656, C5-657, C5-658, C5-659, C5-660, C5-661, C5-662, C5-663, C5-664, C5-665, C5-666, C5-667, C5-668, C5-669, C5-670, C5-671, C5-672, C5-673, C5-674, C5-675, C5-676, C5-677, C5-678, C5-679, C5-680, C5-681, C5-682, C5-683, C5-684, C5-685, C5-686, C5-687, C5-688, C5-689, C5-690, C5-691, C5-692, C5-693, C5-694, C5-695, C5-696, C5-697, C5-698, C5-699, C5-700, C5-701, C5-702, C5-703, C5-704, C5-705, C5-706, C5-707, C5-708, C5-709, C5-710, C5-711, C5-712, C5-713, C5-714, C5-715, C5-716, C5-717, C5-718, C5-719, C5-720, C5-721, C5-722, C5-723, C5-724, C5-725, C5-726, C5-727, C5-728, C5-729, C5-730, C5-731, C5-732, C5-733, C5-734, C5-735, C5-736, C5-737, C5-738, C5-739, C5-740, C5-741, C5-742, C5-743, C5-744, C5-745, C5-746, C5-747, C5-748, C5-749, C5-750, C5-751, C5-752, C5-753, C5-754, C5-755, C5-756, C5-757, C5-758, C5-759, C5-760, C5-761, C5-762, C5-763, C5-764, C5-765, C5-766, C5-767, C5-768, C5-769, C5-770, C5-771, C5-772, C5-773, C5-774, C5-775, C5-776, C5-777, C5-778, C5-779, C5-780, C5-781, C5-782, C5-783, C5-784, C5-785, C5-786, C5-787, C5-788, C5-789, C5-790, C5-791, C5-792, C5-793, C5-794, C5-795, C5-796, C5-797, C5-798, C5-799, C5-800, C5-801, C5-802, C5-803, C5-804, C5-805, C5-806, C5-807, C5-808, C5-809, C5-810, C5-811, C5-812, C5-813, C5-814, C5-815, C5-816, C5-817, C5-818, C5-819, C5-820, C5-821, C5-822, C5-823, C5-824, C5-825, C5-826, C5-827, C5-828, C5-829, C5-830, C5-831, C5-832, C5-833, C5-834, C5-835, C5-836, C5-837, C5-838, C5-839, C5-840, C5-841, C5-842, C5-843, C5-844, C5-845, C5-846, C5-847, C5-848, C5-849, C5-850, C5-851, C5-852, C5-853, C5-854, C5-855, C5-856, C5-857, C5-858, C5-859, C5-860, C5-861, C5-862, C5-863, C5-864, C5-865, C5-866, C5-867, C5-868, C5-869, C5-870, C5-871, C5-872, C5-873, C5-874, C5-875, C5-876, C5-877, C5-878, C5-879, C5-880, C5-881, C5-882, C5-883, C5-884, C5-885, C5-886, C5-887, C5-888, C5-889, C5-890, C5-891, C5-892, C5-893, C5-894, C5-895, C5-896, C5-897, C5-898, C5-899, C5-900, C5-901, C5-902, C5-903, C5-904, C5-905, C5-906, C5-907, C5-908, C5-909, C5-910, C5-911, C5-912, C5-913, C5-914, C5-915, C5-916, C5-917, C5-918, C5-919, C5-920, C5-921, C5-922, C5-923, C5-924, C5-925, C5-926, C5-927, C5-928, C5-929, C5-930, C5-931, C5-932, C5-933, C5-934, C5-935, C5-936, C5-937, C5-938, C5-939, C5-940, C5-941, C5-942, C5-943, C5-944, C5-945, C5-946, C5-947, C5-948, C5-949, C5-950, C5-951, C5-952, C5-953, C5-954, C5-955, C5-956, C5-957, C5-958, C5-959, C5-960, C5-961, C5-962, C5-963, C5-964, C5-965, C5-966, C5-967, C5-968, C5-969, C5-970, C5-971, C5-972, C5-973, C5-974, C5-975, C5-976, C5-977, C5-978, C5-979, C5-980, C5-981, C5-982, C5-983, C5-984, C5-985, C5-986, C5-987, C5-988, C5-989, C5-990, C5-991, C5-992, C5-993, C5-994, C5-995, C5-996, C5-997, C5-998, C5-999, C5-1000, C5-1001, C5-1002, C5-1003, C5-1004, C5-1005, C5-1006, C5-1007, C5-1008, C5-1009, C5-1010, C5-1011, C5-1012, C5-1013, C5-1014, C5-1015, C5-1016, C5-1017, C5-1018, C5-1019, C5-1020, C5-1021, C5-1022, C5-1023, C5-1024, C5-1025, C5-1026, C5-1027, C5-1028, C5-1029, C5-1030, C5-1031, C5-1032, C5-1033, C5-1034, C5-1035, C5-1036, C5-1037, C5-1038, C5-1039, C5-1040, C5-1041, C5-1042, C5-1043, C5-1044, C5-1045, C5-1046, C5-1047, C5-1048, C5-1049, C5-1050, C5-1051, C5-1052, C5-1053, C5-1054, C5-1055, C5-1056, C5-1057, C5-1058, C5-1059, C5-1060, C5-1061, C5-1062, C5-1063, C5-1064, C5-1065, C5-1066, C5-1067, C5-1068, C5-1069, C5-1070, C5-1071, C5-1072, C5-1073, C5-1074, C5-1075, C5-1076, C5-1077, C5-1078, C5-1079, C5-1080, C5-1081, C5-1082, C5-1083, C5-1084, C5-1085, C5-1086, C5-1087, C5-1088, C5-1089, C5-1090, C5-1091, C5-1092, C5-1093, C5-1094, C5-1095, C5-1096, C5-1097, C5-1098, C5-1099, C5-1100, C5-1101, C5-1102, C5-1103, C5-1104, C5-1105, C5-1106, C5-1107, C5-1108, C5-1109, C5-1110, C5-1111, C5-1112, C5-1113, C5-1114, C5-1115, C5-1116, C5-1117, C5-1118, C5-1119, C5-1120, C5-1121, C5-1122, C5-1123, C5-1124, C5-1125, C5-1126, C5-1127, C5-1128, C5-1129, C5-1130, C5-1131, C5-1132, C5-1133, C5-1134, C5-1135, C5-1136, C5-1137, C5-1138, C5-1139, C5-1140, C5-1141, C5-1142, C5-1143, C5-1144, C5-1145, C5-1146, C5-1147, C5-1148, C5-1149, C5-1150, C5-1151, C5-1152, C5-1153, C5-1154, C5-1155, C5-1156, C5-1157, C5-1158, C5-1159, C5-1160, C5-1161, C5-1162, C5-1163, C5-1164, C5-1165, C5-1166, C5-1167, C5-1168, C5-1169, C5-1170, C5-1171, C5-1172, C5-1173, C5-1174, C5-1175, C5-1176, C5-1177, C5-1178, C5-1179, C5-1180, C5-1181, C5-1182, C5-1183, C5-1184, C5-1185, C5-1186, C5-1187, C5-1188, C5-1189, C5-1190, C5-1191, C5-1192, C5-1193, C5-1194, C5-1195, C5-1196, C5-1197, C5-1198, C5-1199, C5-1200, C5-1201, C5-1202, C5-1203, C5-1204, C5-1205, C5-1206, C5-1207, C5-1208, C5-1209, C5-1210, C5-1211, C5-1212, C5-1213, C5-1214, C5-1215, C5-1216, C5-1217, C5-1218, C5-1219, C5-1220, C5-1221, C5-1222, C5-1223, C5-1224, C5-1225, C5-1226, C5-1227, C5-1228, C5-1229, C5-1230, C5-1231, C5-1232, C5-1233, C5-1234, C5-1235, C5-1236, C5-1237, C5-1238, C5-1239, C5-1240, C5-1241, C5-1242, C5-1243, C5-1244, C5-1245, C5-1246, C5-1247, C5-1248, C5-1249, C5-1250, C5-1251, C5-1252, C5-1253, C5-1254, C5-1255, C5-1256, C5-1257, C5-1258, C5-1259, C5-1260, C5-1261, C5-1262, C5-1263, C5-1264, C5-1265, C5-1266, C5-1267, C5-1268, C5-1269, C5-1270, C5-1271, C5-1272, C5-1273, C5-1274, C5-1275, C5-1276, C5-1277, C5-1278, C5-1279, C5-1280, C5-1281, C5-1282, C5-1283, C5-1284, C5-1285, C5-1286, C5-1287, C5-1288, C5-1289, C5-1290, C5-1291, C5-1292, C5-1293, C5-1294, C5-1295, C5-1296, C5-1297, C5-1298, C5-1299, C5-1300, C5-1301, C5-1302, C5-1303, C5-1304, C5-1305, C5-1306, C5-1307, C5-1308, C5-1309, C5-1310, C5-1311, C5-1312, C5-1313, C5-1314, C5-1315, C5-1316, C5-1317, C5-1318, C5-1319, C5-1320, C5-1321, C5-1322, C5-1323, C5-1324, C5-1325, C5-1326, C5-1327, C5-1328, C5-1329, C5-1330, C5-1331, C5-1332, C5-1333, C5-1334, C5-1335, C5-1336, C5-1337, C5-1338, C5-1339, C5-1340, C5-1341, C5-1342, C5-1343, C5-1344, C5-1345, C5-1346, C5-1347, C5-1348, C5-1349, C5-1350, C5-1351, C5-1352, C5-1353, C5-1354, C5-1355, C5-1356, C5-1357, C5-1358, C5-1359, C5-1360, C5-1361, C5-1362, C5-1363, C5-1364, C5-1365, C5-1366, C5-1367, C5-1368, C5-1369, C5-1370, C5-1371, C5-1372, C5-1373, C5-1374, C5-1375, C5-1376, C5-1377, C5-1378, C5-1379, C5-1380, C5-1381, C5-1382, C5-1383, C5-1384, C5-1385, C5-1386, C5-1387, C5-1388, C5-1389, C5-1390, C5-1391, C5-1392, C5-1393, C5-1394, C5-1395, C5-1396, C5-1397, C5-1398, C5-1399, C5-1400, C5-1401, C5-1402, C5-1403, C5-1404, C5-1405, C5-1406, C5-1407, C5-1408, C5-1409, C5-1410, C5-1411, C5-1412, C5-1413, C5-1414, C5-1415, C5-1416, C5-1417, C5-1418, C5-1419, C5-1420, C5-1421, C5-1422, C5-1423, C5-1424, C5-1425, C5-1426, C5-1427, C5-1428, C5-1429, C5-1430, C5-1431, C5-1432, C5-1433, C5-1434, C5-1435, C5-1436, C5-1437, C5-1438, C5-1439, C5-1440, C5-1441, C5-1442, C5-1443, C5-1444, C5-1445, C5-1446, C5-1447, C5-1448, C5-1449, C5-1450, C5-1451, C5-1452, C5-1453, C5-1454, C5-1455, C5-1456, C5-1457, C5-1458, C5-1459, C5-1460, C5-1461, C5-1462, C5-1463, C5-1464, C5-1465, C5-1466, C5-1467, C5-1468, C5-1469, C5-1470, C5-1471, C5-1472, C5-1473, C5-1474, C5-1475, C5-1476, C5-1477, C5-1478, C5-1479, C5-1480, C5-1481, C5-1482, C5-1483, C5-1484, C5-1485, C5-1486, C5-1487, C5-1488, C5-1489, C5-1490, C5-1491, C5-1492, C5-1493, C5-1494, C5-1495, C5-1496, C5-1497, C5-1498, C5-1499, C5-1500, C5-1501, C5-1502, C5-1503, C5-1504, C5-1505, C5-1506, C5-1507, C5-1508, C5-1509, C5-1510, C5-1511, C5-1512, C5-1513, C5-1514, C5-1515, C5-1516, C5-1517, C5-1518, C5-1519, C5-1520, C5-1521, C5-1522, C5-1523, C5-1524, C5-1525, C5-1526, C5-1527, C5-1528, C5-1529, C5-1530, C5-1531, C5-1532, C5-1533, C5-1534, C5-1535, C5-1536, C5-1537, C5-1538, C5-1539, C5-1540, C5-1541, C5-1542, C5-1543, C5-1544, C5-1545, C5-1546, C5-1547, C5-1548, C5-1549, C5-1550, C5-1551, C5-1552, C5-1553, C5-1554, C5-1555, C5-1556, C5-1557, C5-1558, C5-1559, C5-1560, C5-1561, C5-1562, C5-1563, C5-1564, C5-1565, C5-1566, C5-1567, C5-1568, C5-1569, C5-1570, C5-1571, C5-1572, C5-1573, C5-1574, C5-1575, C5-1576, C5-1577, C5-1578, C5-1579, C5-1580, C5-1581, C5-1582, C5-1583, C5-1584, C5-1585, C5-1586, C5-1587, C5-1588, C5-1589, C5-1590, C5-1591, C5-1592, C5-1593, C5-1594, C5-1595, C5-1596, C5-1597, C5-1598, C5-1599, C5-1600, C5-1601, C5-1602, C5-1603, C5-1604, C5-1605, C5-1606, C5-1607, C5-1608, C5-1609, C5-1610, C5-1611, C5-1612, C5-1613, C5-1614, C5-1615, C5-1616, C5-1617, C5-1618, C5-1619, C5-1620, C5-1621, C5-1622, C5-1623, C5-1624, C5-1625, C5-1626, C5-1627, C5-1628, C5-1629, C5-1630, C5-1631, C5-1632, C5-1633, C5-1634, C5-1635, C5-1636, C5-1637, C5-1638, C5-1639, C5-1640, C5-1641, C5-1642, C5-1643, C5-1644, C5-1645, C5-1646, C5-1647, C5-1648, C5-1649, C5-1650, C5-1651, C5-1652, C5-1653, C5-1654, C5-1655, C5-1656, C5-1657, C5-1658, C5-1659, C5-1660, C5-1661, C5-1662, C5-1663, C5-1664, C5-1665, C5-1666, C5-1667, C5-1668, C5-1669, C5-1670, C5-1671, C5-			

AN3CSA BOLT
D3672-1 PHENOLIC WASHER
NAS1148C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

AN3CSA BOLT
NAS1148C0332R WASHER
24 PL

PLUG UNUSED INSERTS WITH
AN3CSA BOLT
NAS1148C0332R WASHER
8 PL

D3847-1
WEARPAD
8 PL

SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D2855-3 CAP

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF

1.5
1.5
1.5
2.00 DISTANCE TO D3885-1 WEB, REF

1.5
1.5

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-580 AP

RELEASED

2014 NOV 24 *q*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2000 BY DART AEROSPACE USA, INC. THIS DRAWING IS PROPERTY OF DART AEROSPACE USA, INC. AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR REPRODUCED IN ANY MANNER WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

AN3CSA BOLT
D3672-1 PHENOLIC WASHER
NAS1148C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

D3847-047
AFT WEARPLATE ASSY

AN3CSA BOLT
NAS1148C0332R WASHER
30 PL

D3847-045
CENTER WEARPLATE ASSY

D3847-043
FWD WEARPLATE ASSY

D3847-1
WEARPAD
5 PL

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø 0.187
8 PL PER SIDE
REF

2.00 DISTANCE TO D3885-1 WEB, REF

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-580 AP

RELEASED

2014 NOV 24 *q*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DRAWING IS UNCLASSIFIED AND IS SUPPLIED TO THE EXTENT PERMITTED BY THE EXPORT ADMINISTRATION REGULATIONS OF THE UNITED STATES OF AMERICA	

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1148C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

AN3C46A BOLT
D3804-1 WASHER, 2 PL
MS21043-3 NUT
8 PL

D3849-043
AFT TRAINING WEARPLATE ASSY

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

1.5 1.5 1.5

2.00 DISTANCE TO D3885-1 WEB

1.5 1.5

1.5 D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24894-C52 SCREW
(1 PER SIDE)

D3849-041
FWD TRAINING WEARPLATE ASSY

D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE
(MAKE FROM D3887-13)

UNDER REVIEW


15.04.30 URF15-580 AP

RELEASED


2014 NOV 24 *qp*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DS	KENT, WA	
CHECKED	DS	DRAWING NO.	REV. D
MFG. APPR.	DS	D3887	SHEET 4 OF 6
APPROVED	DS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS AVAILABLE TO THE PUBLIC WITHOUT LIMITATION UNLESS INDICATED OTHERWISE	


DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS THE PROPERTY OF DART AEROSPACE USA, INC. NO PARTS USED FOR ANY PURPOSES ARE TO BE REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS WITHOUT PERMISSION IN WRITING FROM DART AEROSPACE USA, INC.	

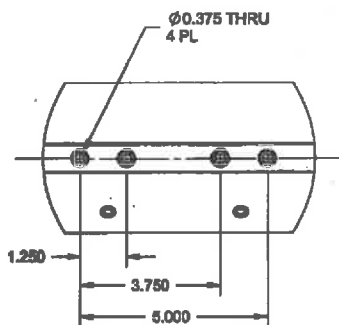


DETAIL A
SCALE 4X
D7-5
C3-5
D7-6
C3-6

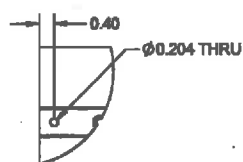


DETAIL F
SCALE 4X
C8-5
C8-6

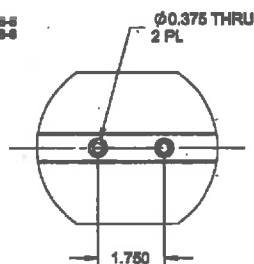

DETAIL B
SCALE 4X
C8-5
C8-6
C8-8
C8-9

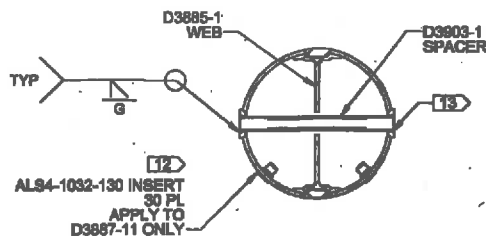


SECTION D-D
SCALE 4X
C7-5
C3-5
C7-6
C2-8
(FOR 12 X Ø0.375 HOLES
PER SKIDTUBE)

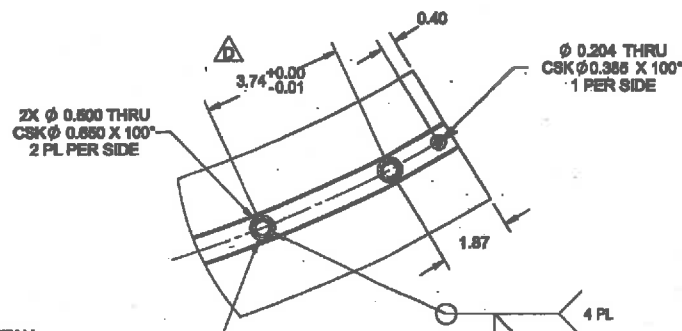

DETAIL C
TYPICAL
SCALE 4X
C1-5
C1-6

INSTALL
D2579 CROSS BOLT SPACER
2 PL

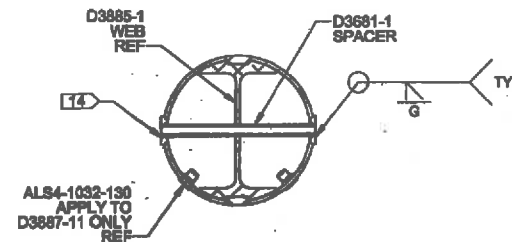

SECTION E-E
SCALE 4X
C4-5
C4-6
(FOR 8 X Ø0.313 HOLES
PER SKIDTUBE)

NOTES:

- 13) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.375 HOLES ONLY:
i) CHAMFER HOLES Ø0.475 x 45°
ii) INSERT D3881-1 SPACER
iii) WELD INTO PLACE AND GRIND FLUSH
iv) CBORER TO 0.313 x 0.75 DEEP
v) DEBURR HOLES

- 14) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.313 HOLES ONLY:
vi) CHAMFER HOLES Ø0.384 x 45° OR 0.080 DEEP x 45° (BOTH SIDES)
vii) INSERT D3881-1 SPACER
viii) WELD INTO PLACE AND GRIND FLUSH
ix) DEBURR HOLES


UNDER REVIEW

15.04.30 URF15-580 AP

RELEASED

2014 NOV 24

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	5	DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NIS
DATE	13.09.20	COPYRIGHT © 2000 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS AVAILABLE TO THE PUBLIC WITHOUT LIMITATION HOWEVER, IT IS THE PROPERTY OF DART AEROSPACE USA, INC. AND IS NOT TO BE REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS, ELECTRONIC OR MECHANICAL, INCLUDING PHOTOCOPYING, RECORDING, OR BY ANY INFORMATION STORAGE AND RETRIEVAL SYSTEM, WITHOUT PERMISSION IN WRITING FROM DART AEROSPACE USA, INC.	

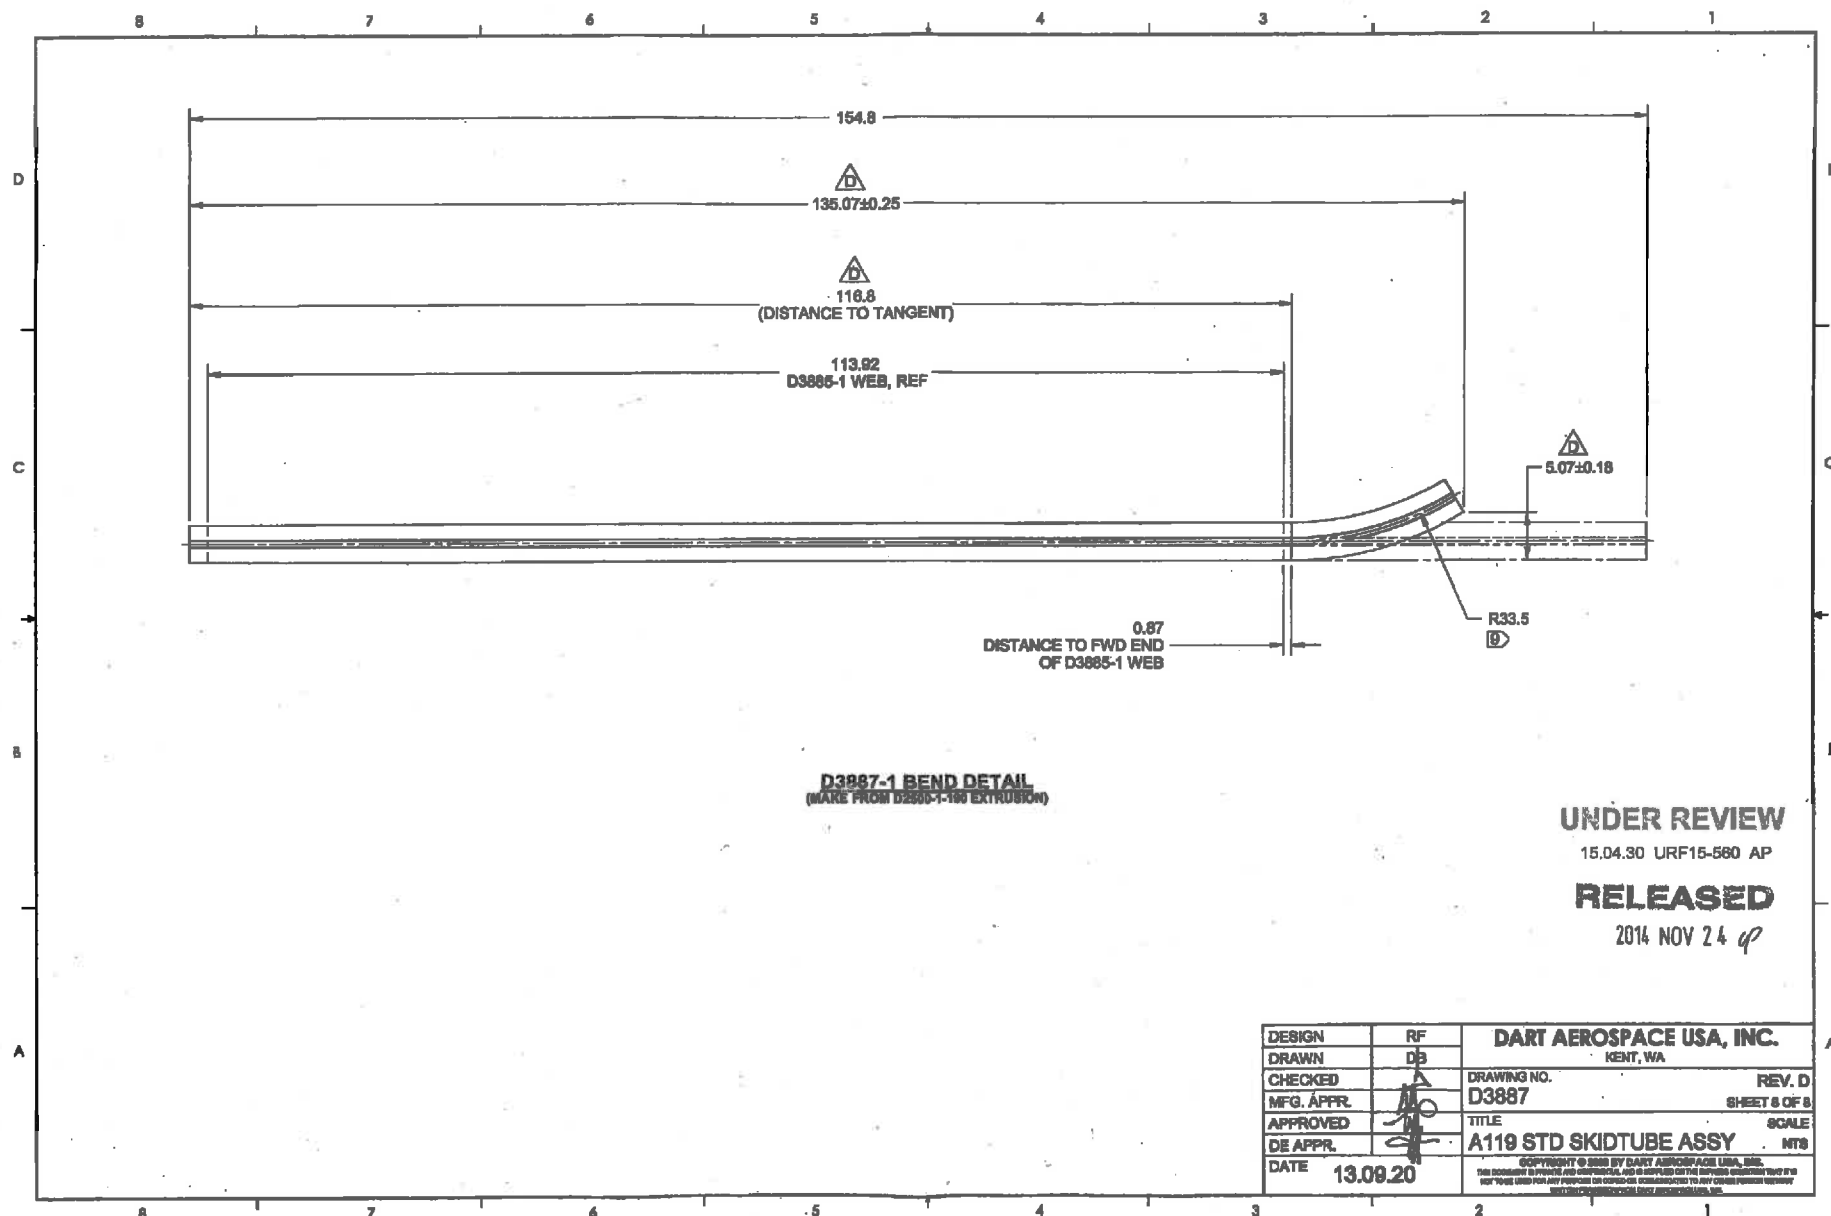

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	DB	DRAWING NO.	REV. D
MFG. APPR.	DB	D3887	SHEET 8 OF 8
APPROVED	DB	TITLE	SCALE
DE APPR.	DB	A119 STD SKIDTUBE ASSY	MTS
DATE	13.09.20	COPYRIGHT © 2000 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR REPRODUCED IN ANY MANNER WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

DQA: _____ Date: _____

QA Closed: DA Date: 16-08-15**WORK ORDER NON-CONFORMANCE / UPDATE**

Work Order update only

Work Order: 145320Part No. D119-646041NCR No. 16-5978**DISPOSITION**Rework ☒Scrap ☐Use-as-is ☐Suspected Unapproved ☐**AGAINST DEPARTMENT/PROCESS**Skid-tube ☐Machining ☐Thermoforming ☐Large Fab ☐Cross tube ☐Small Fab ☐Finishing ☐Composite ☐Water Jet ☐Prod. Eng. Coord. ☐Rec/Store/Packaging ☐Supplier ☐Engineering ☒Quality ☐Other ☐Date: 16/5/16Step #: 200QTY Effective: ②

MRB (QSI042) Approval

DAS
12
9-89
16/5/19
Description Work Order Deviation**Disposition**

No powder coat on saddle region per
customer request.

Acceptable per attached marking instructions

Completed By

16-07-7
Lead hand / Supervisor
Approval Verification
DAS
9
9-89
16-07-21

QC / QA Coordinator

Approval

DAS
9
9-89
16-07-22
Root Cause

Environment	☐	No Re-verification	☐
Design	☒	Operator	☐
Doc/Data	☐	Offset/Setup	☐
Equip/Tooling	☐	Supplier	☐
Handling/Pre	☐	Training	☐
Material	☐	Use for Testing	☐
Internal Transport	☐	Poor Information	☐
Tribal Knowledge	☐	Rushing	☐
LOA	☐	Product Improvement	☐
Substation	☐	Process Improvement	☐
Past Expiry Date	☐	Manufacturing Process	☐
Misidentified	☐	Past Due	☐

Pressure/Forced

Bending

Centre Not Concentric

Cracks

Crimp/Kink/Ripple/Wave

Cuffs

Crushing

Heat Treat

Wave/Twist in Tube

Marks/Chatter

FAULT CATEGORY

Temperature/Cure

Set-up

BOM/Route

Broken/Damage/Defect

Inspection Incomplete/Unqualified

Contamination

Countersink

Cut Too Short

Instructions Incomplete/Unclear

Drill Holes

Power Loss/Surge

Folio/Program

Grain

Weld

Wrong Stock Pulled

Out of Sequence

Off-set

Mislabeled

Fit/Function

Misaligned/off center

Positioned Wrong

Outside Dimensions

Over/Under tolerance

Part Incorrect

Part Lost/Missing

Part Moved


Drawing

Finish

Misread

Turning Sequence

☒ OTHER: Customer

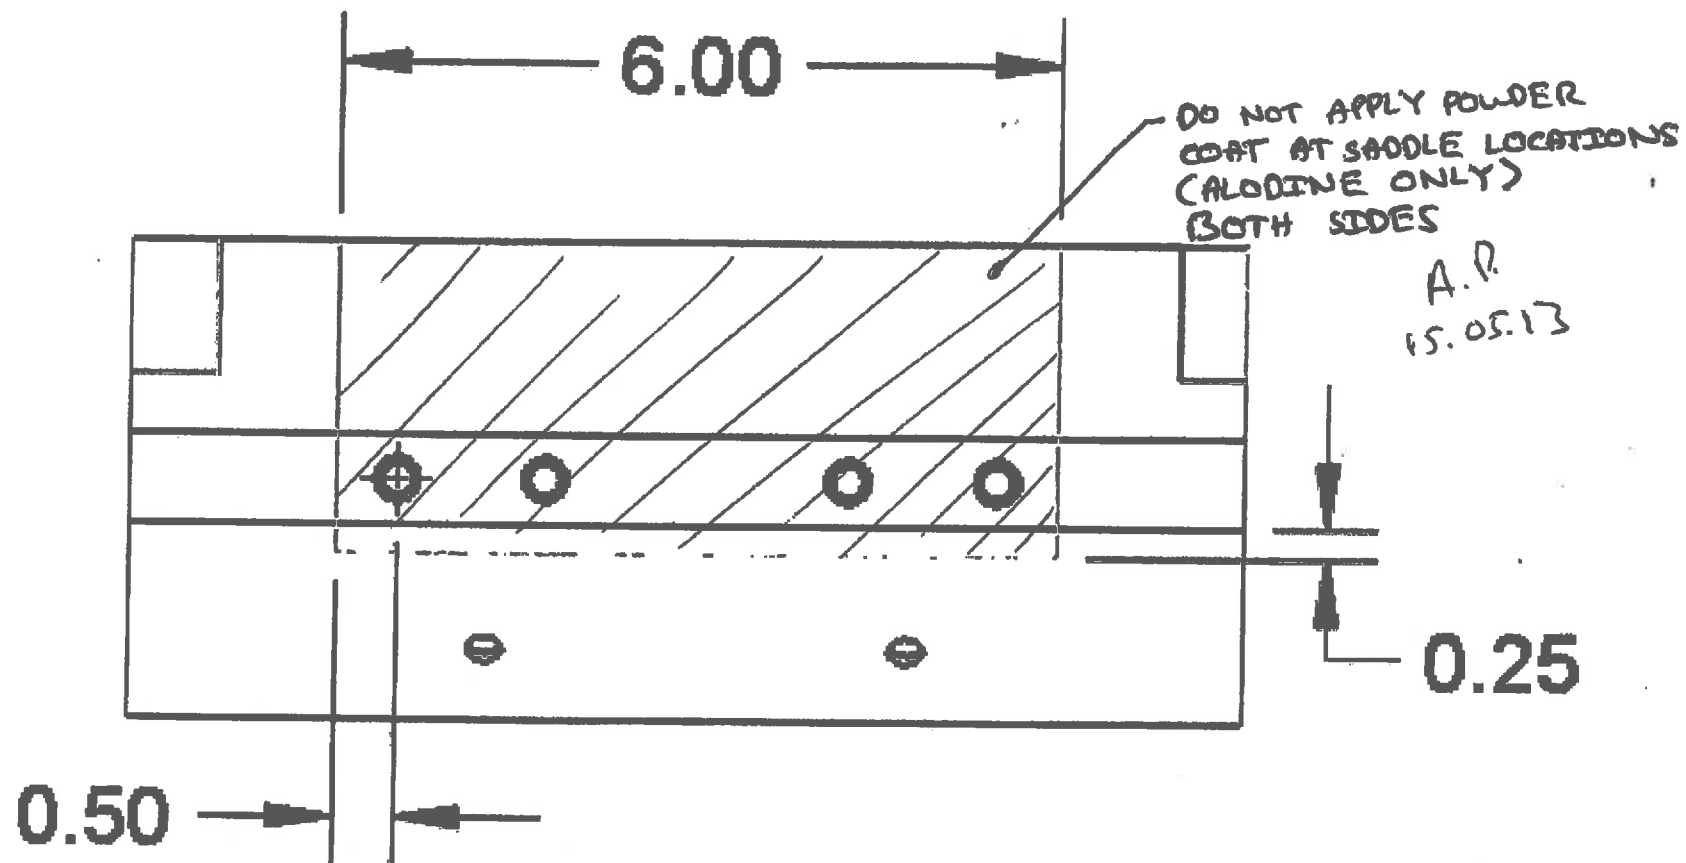

DQA: ant Date: 16.08.29QA Closed: RPA Date: 16.08/15

WORK ORDER NON-CONFORMANCE / UPDATE

Work Order update only



Work Order: <u>145320</u>		DISPOSITION		AGAINST DEPARTMENT/PROCESS							
Part No. <u>2119-646-04</u>		Rework ☒		Skid-tube ☐		Cross tube ☐		Water Jet ☐		Engineering ☒	
NCR No. <u>16-5979</u>		Scrap ☐		Machining ☐		Small Fab ☐		Prod. Eng. Coord. ☐		Quality ☐	
		Use-as-is ☐		Thermoforming ☐		Finishing ☐		Rec/Store/Packaging ☐		Other ☐	
Suspected Unapproved ☐		Large Fab ☐		Composite ☐		Supplier ☐					
Date: <u>16/3/16</u>		Step #: <u>240</u>		QTY Effective: <u>1</u>				MRB (QSI042) Approval			
Description Work Order Deviation				Disposition				DAS 12 9-89 <u>16/5/19</u>			
Plug unused holes with AN3C4A Bolts rather than AN3CSA Bolts.				Acceptable AN3C-4A / M1135127 (x6)				Completed By <u>DAS 15 9-89</u> <u>16/07/08</u>			
								Lead hand / Supervisor Approval Verification			
								DAS 9 9-89 <u>16.07.22</u>			
								QC / QA Coordinator Approval			
DAS 9 9-89 <u>16.07.22</u>											
Root Cause				FAULT CATEGORY							
Environment ☐ No Re-verification ☐ Design ☒ Operator ☐ Doc/Data ☐ Offset/Setup ☐ Equip/Tooling ☐ Supplier ☐ Handling/Pre ☐ Training ☐ Material ☐ Use for Testing ☐ Internal Transport ☐ Poor Information ☐ Tribal Knowledge ☐ Rushing ☐ LOA ☐ Product Improvement ☐ Substation ☐ Process Improvement ☐ Past Expiry Date ☐ Manufacturing Process ☐ Misidentified ☐ Past Due ☐				Pressure/Forced ☐ Temperature/Cure ☐ Power Loss/Surge ☐ Positioned Wrong ☐ Bending ☐ Set-up ☐ Folio/Program ☐ Outside Dimensions ☐ Centre Not Concentric ☐ BOM/Route ☐ Grain ☐ Over/Under tolerance ☐ Cracks ☐ Broken/Damage/Defect ☐ Weld ☐ Part Incorrect ☐ Crimp/Kink/Ripple/Wave ☐ Inspection Incomplete/Unqualified ☐ Wrong Stock Pulled ☐ Part Lost/Missing ☐ Cuffs ☐ Contamination ☐ Out of Sequence ☐ Part Moved ☐ Crushing ☐ Countersink ☐ Off-set ☐ Drawing ☐ Heat Treat ☐ Cut Too Short ☐ Mislabeled ☐ Finish ☐ Wave/Twist in Tube ☐ Instructions Incomplete/Unclear ☒ Fit/Function ☐ Misread ☐ Marks/Chatter ☐ Drill Holes ☐ Misaligned/off center ☐ Turning Sequence ☐							
OTHER :											